

Imagery Analysis Division

19067

DECLASS REVIEW by NIMA/DOD

ASSESSMENT OF BOMB DAMAGE

ALONG THE HANOI

VINH RAIL LINE

CIA/PIR 65012

DATE August 1965

GEGDET

MO FOREIGN DISSEM E

SECRET 25X1C

NO FOREIGN DISSEM

CIA/PIR-65012

CIA IMAGERY ANALYSIS DIVISION

ASSESSMENT OF BOMB DAMAGE ALONG THE HANOI - VINH RAIL LINE

This report is based on an analysis of recent serial photography in an effort to determine the extent of bomb damage to the Hanoi - Vinh Rail Line and also to determine the compensative action (if any) taken by the North Vietnamese in an attempt to rehabilitate their railroads.

Bomb damaged facilities described herein are annotated on the enclosed maps (Figures 1 through 5) and selected examples are illustrated by the enclosed annotated photographs (Figures 6 through 9). Facilities annotated on the enclosed maps are in the same numerical sequence in the text of this report. Details are as follows:

- 1. No recent good quality photographic coverage.
- 2. Rail line serviceable. No apparent damage to yards or bridges.
- 3. Ninh Binh combination rail and highway bridge 20 15N 105 59E is unserviceable, one span dropped. No evidence of repair. A ferry crossing currently under construction is located immediately west of the bridge. (See Photo No. 1)
- 4. Bien Son rail yard 20 03N 105 51E was damaged, several bomb craters are apparent in the yard. No apparent attempt was made to repair this yard.
- 5. Dong Phong Thuong combination rail and highway bridge 19 59N 105 50E is unserviceable, two spans were dropped and one dammaged, there was no evidence of any attempt to repair. A ferry site, under construction, is located immediately east of the bridge. (See Photo No. 2)
- 6. Then Hos combination rail and highway bridge 19 50N 105 47 is serviceable to truck traffic and possible serviceable to rail traffic. Damaged approaches to the bridge have been repaired. A ferry site is located immediately east of the bridge.

SECRET
NO FOREIGN DISSEM 25X1C

CE	rv	
. Э.Г	L.K	E- 1

CIA/PIR-65012

NO FOREIGN DISSEM


25X1C


CIA IMAGERY ANALYSIS DIVISION


- 7. 19 39N 105 42E rail line interdicted on the north approach to a small bridge. There was no evidence of any attempt to repair the rail line.
- 8. Thuong Quang rail bridge 19 37N 105 42E was heavily damaged. There was no evidence of any attempt to repair the bridge. A possible ferry site under construction is located immediately west of the bridge.
- 9. 19 32N 105 42E rail interdicted on both approaches of a small bridge. A ferry crossing under construction is located immediately west of the bridge.
- 10. When My rail yard 19 26N 105 45E is heavily damaged. Rail interdicted at several points. There are ten pieces of damaged rolling stock abandoned in the yard. No evidence of any attempt to repair.
- 11. Dong Ky rail bridge 19 21N 105 43E was heavily damaged. The southernmost span appears to be dislocated, and the southern approach is also interdicted. No evidence of any attempt to repair the bridge. No ferry crossing located at this site.
- 12. Qui Vinh rail bridge 19 15N 105 41E has the two northernmost spans dropped. The northern approach was heavily damaged. There was no evidence of any attempt to repair the rail line; however, a possible temporary rail bridge is being constructed immediately east of the destroyed bridge and a possible by-pass line is under construction in this area. (See Photo No. 3)
- 13. Dien Chau rail bridge 18 58N 105 34E was heavily damaged. There was no evidence of any attempt to repair the bridge. No ferry crossing in this area.
- 14. Tam Da combination rail and highway bridge 18 50N 105 39E was heavily damaged. The rail was interdicted on both approaches and there was no evidence of any attempt to repair the rail line. A ferry crossing is located immediately west of the bridge.
- 15. Vinh rail yards NW 18 40N 105 39E were heavily damaged. There are several bomb craters presently in the yard. There was no evidence of any attempt to repair the yards. There ar 62 pieces of rolling stock on the main line immediately north of the yards. (See Photo No. 4)


SECRET
NO FOREIGN DISSEM 25X1C


2 -

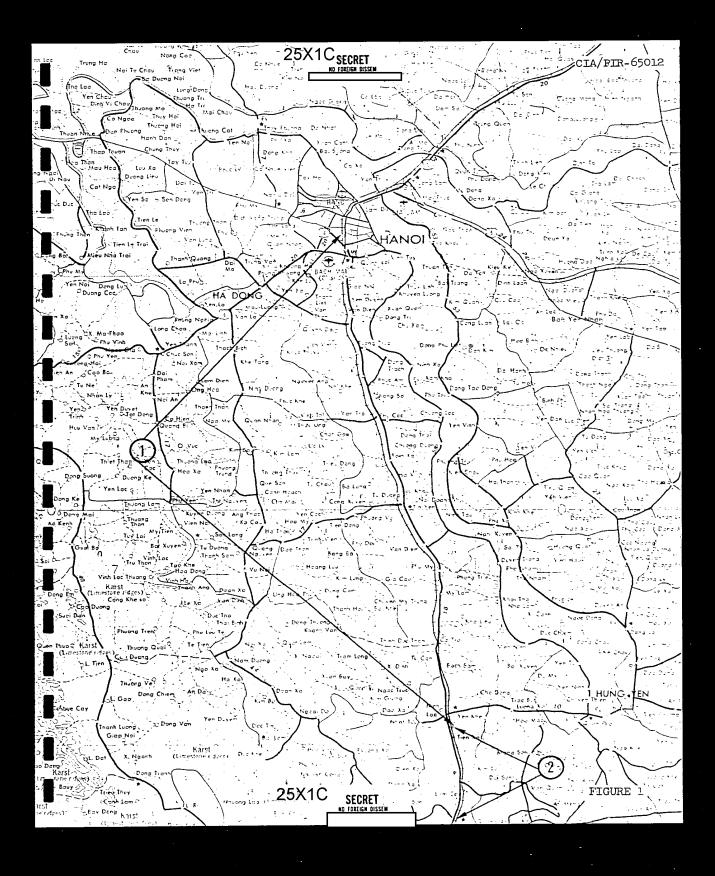


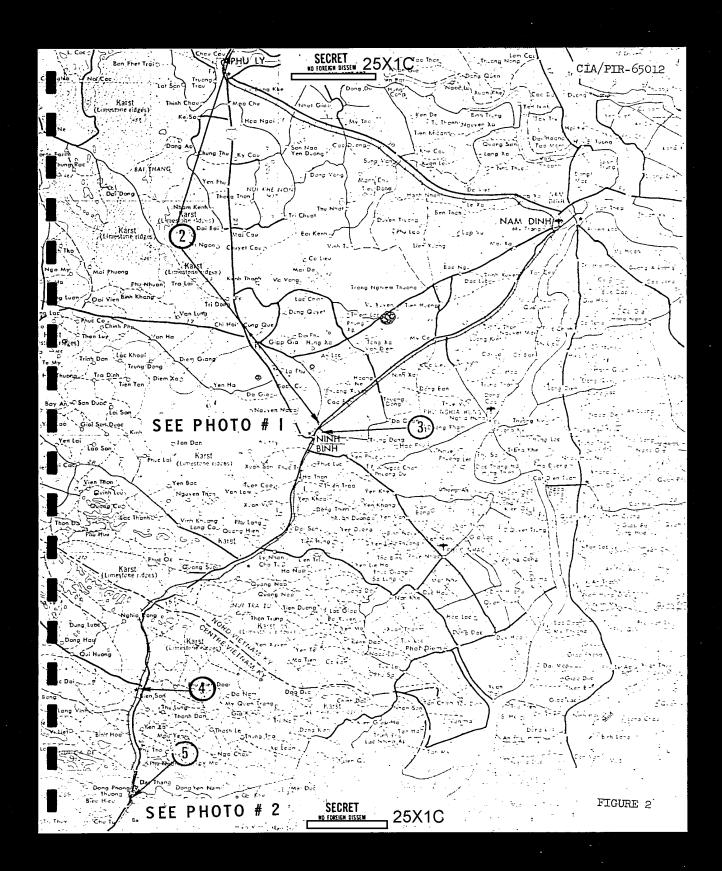


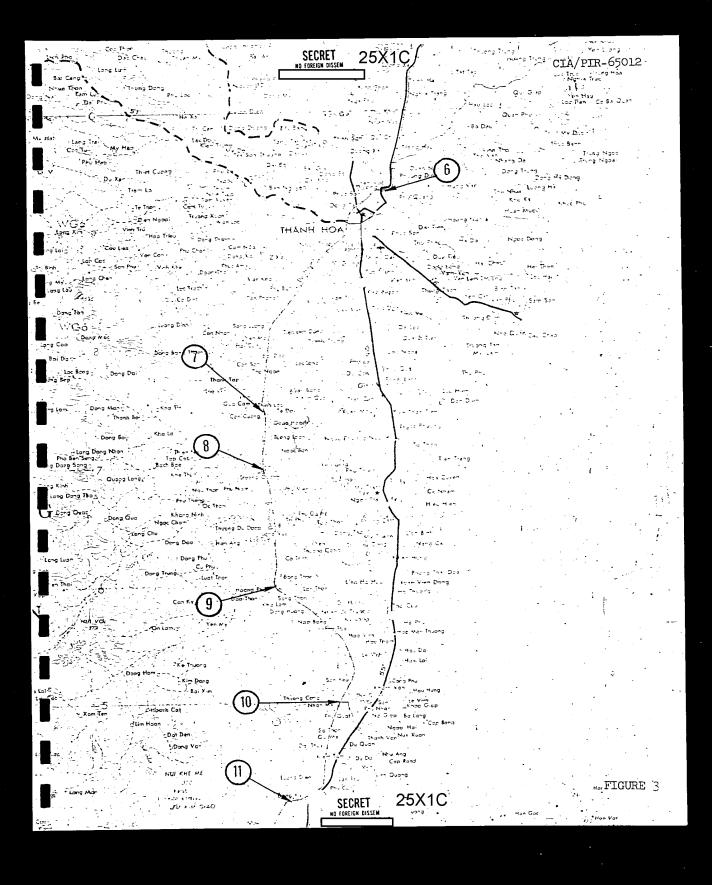

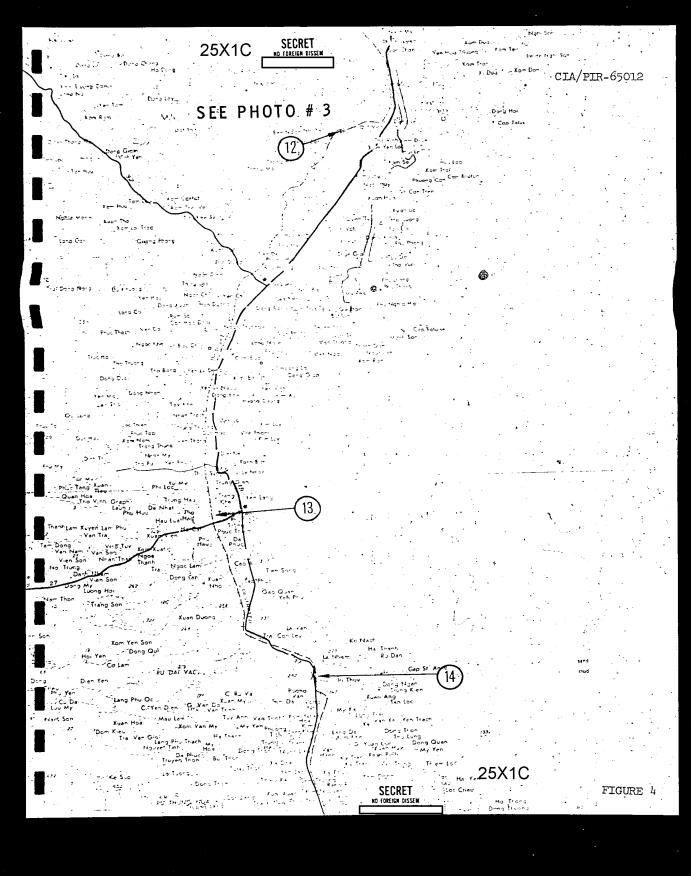

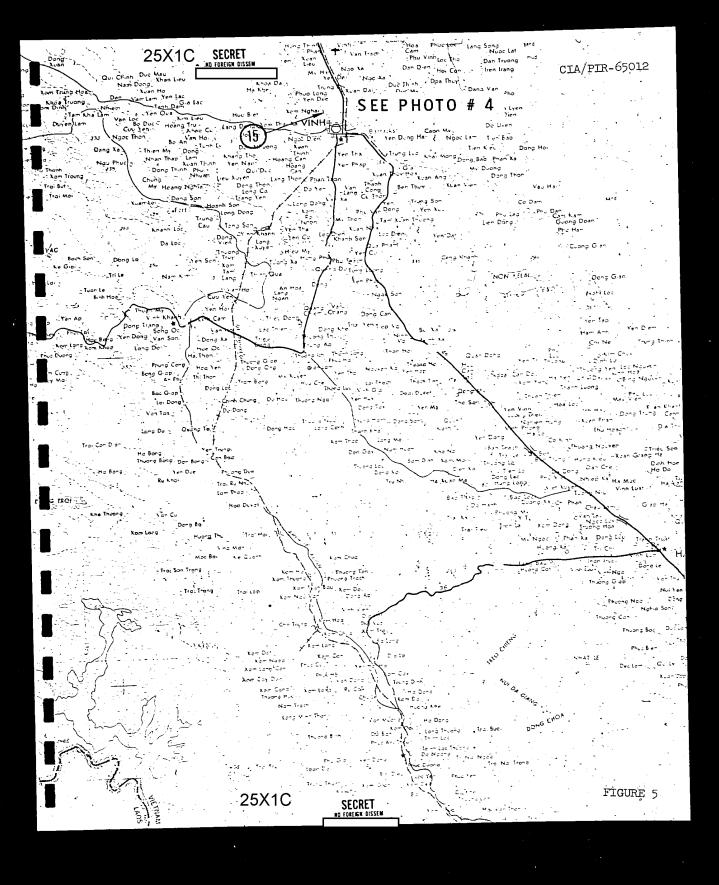

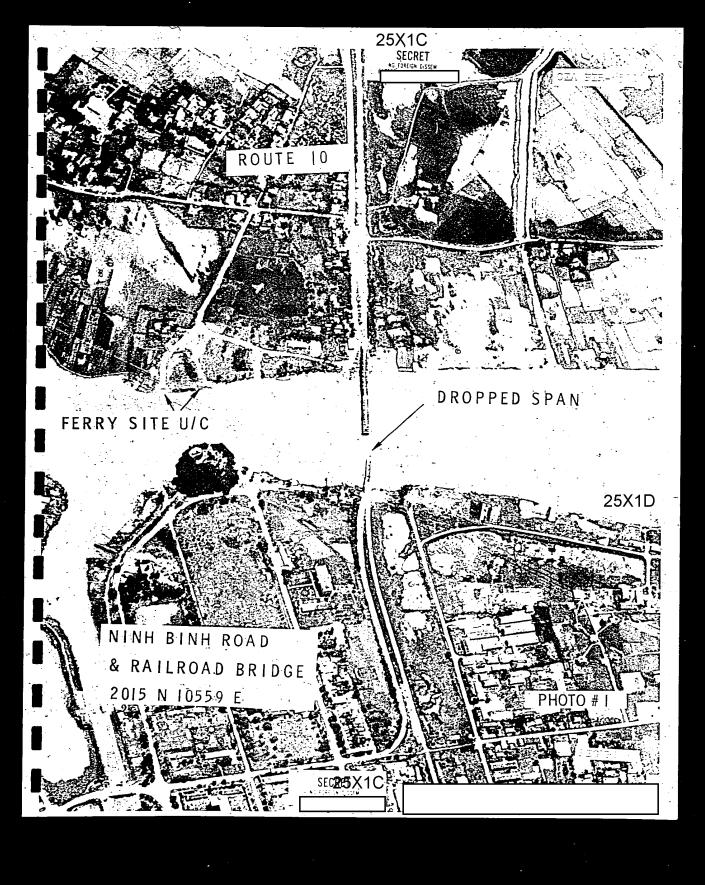

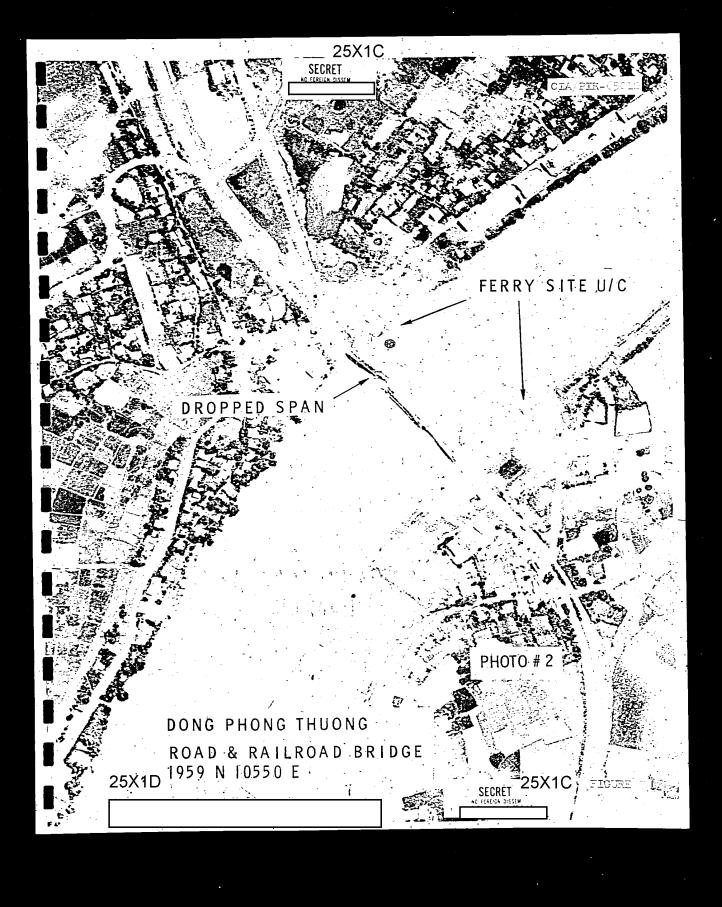

BRIDGE U/C

TEMPORARY

BY-PASS LINE

POSSIBLE BY-PASS

RAIL LINE U/C

DROPPED SPAN

PHOTO #3

QUI VINH RAILROAD BRIDGE 1915 N 10541 E

25X1D

- SECRET

25X1C

FIGURE 8

25X1C SECRET CARS AGED INE INTERDICTION 1840 N 10539 E



ILLEGIB

25X1C

TOS SCORE

BRIDGE CRARE

BRIDGE CRARE

BRIDGE CRARE

BRIDGE CRARE

BRIDGE CRARE

BRIDGE CRARE

FERE
BRIDGE CRARE

FERE
BRIDGE CRARE

BRIDGE CRARE


FERE
BRIDGE CRARE

BRIDGE CRARE

FERE
BRIDGE CRARE

BRIDGE

FIGURE 2

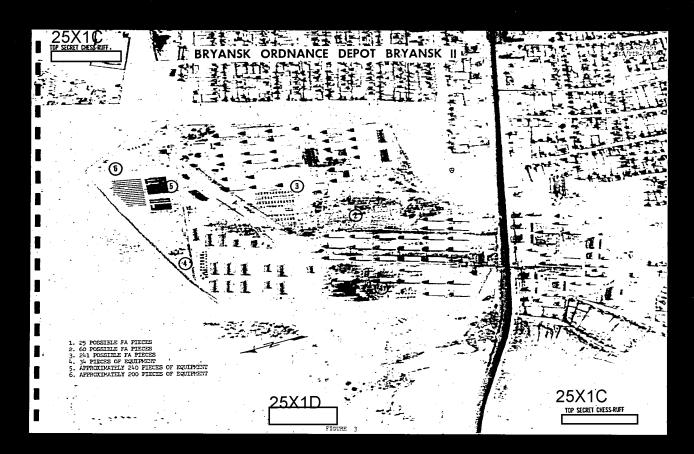


TCS 9602/65 CIA/PIR-67009

TOP SECRET CHESS-RUFF

25X1C

EUILDINGS

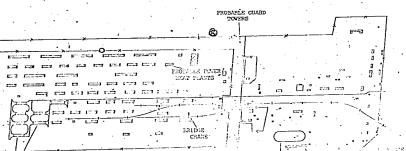


REGICHEVKA CREMANCE PEPOT TURRITORIUM


O 500 1000 (Approximate) FIGURE 4

ORGINGLE OCURES

TOP SECRET CHESS-RUFF

25X1C

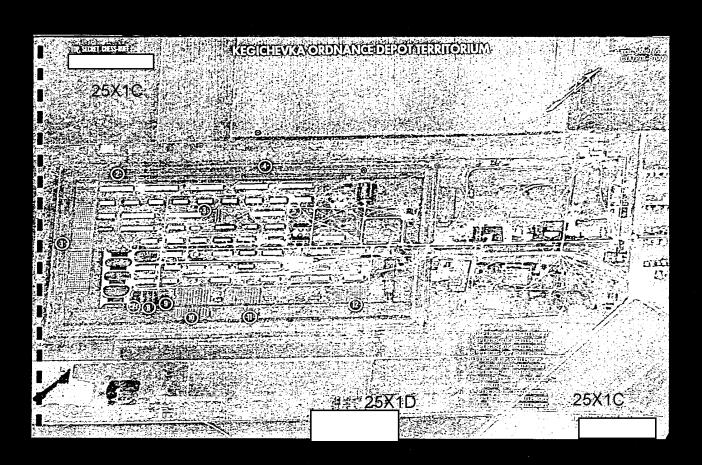


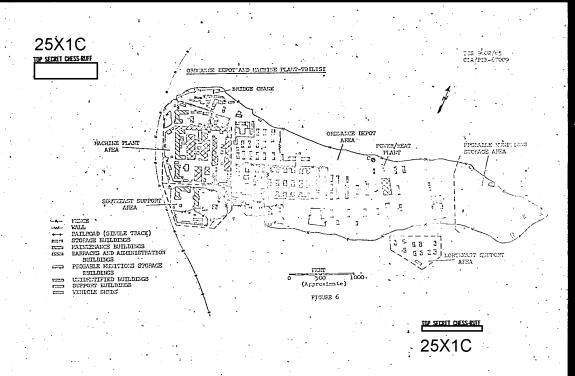



PRODUCE AND TABLE OF ANY TRANSPORT HAS ANY TRANS



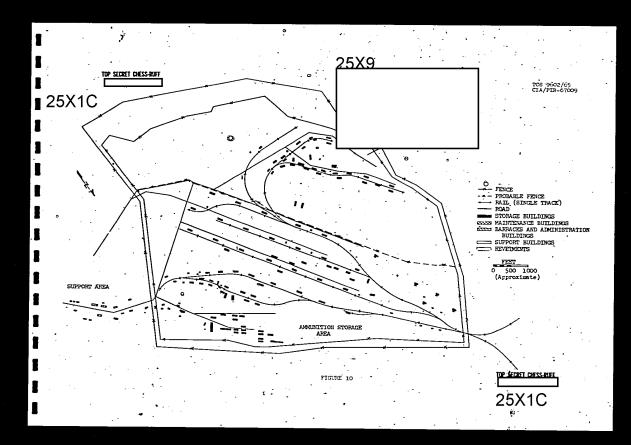

25X9

